



PUBLIC SWIMMING POOLS
WELLNESS AREAS
SPAS
THALASSOTHERAPY &
BALNEOTHERAPY
HYDROTHERAPY



**ULTRA NATURAL TECHNOLOGY** 

www.uvgermi.fr

# **UVDECHLO**DD300 ECOENERGY

Flow rate: from 200 to 300 m<sup>3</sup>/h

**REF**: 23000152

Automatic control using chloramine concentrations\*



The **UVDECHLO DD300** reduces the level of combined chlorine in swimming pools through a photochemical action on all organochlorine compounds found in the water (monochloramine, dichloramine trichloramine). It also destroys Giardia and Cryptosporidum.

## TECHNICAL SPECIFICATIONS



Equipment approved by the Ministry of Health under No. 050021

#### **UV LAMP**

Total electrical power: 1200 Watts (4 lamps)

UV dose at the end of lamp service life: 60 mJ/cm²

Lamp service life: 16,000 hours or 2 years

#### **UV REACTOR**

Treatment chamber:	Stainless steel 316L
Input/Output:	DN 200/PVC 225
Operating pressure:	2 bars

#### **ELECTRICAL CABINET**

 Dimensions (mm):
 500 x 500 x 250

 Power supply:
 400 V

**Display:** Hour counter / Stop-start counter / Lamp replacement pre-alarm & alarm / Lamp defect / Chloramine level control (\*analyser not supplied)


#### **ASSOCIATED PRODUCTS**


300 W UV lamp:	23000232
Quartz sleeve:	14000089
Seals (x 2):	14000088


# **UVDECHLO** DD300 ECOENERGY

Flow rate: from 200 to 300 m<sup>3</sup>/h

**BEF**- 23000152

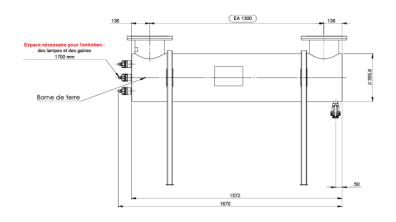

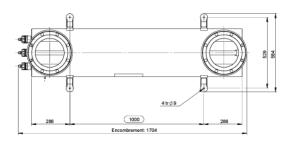

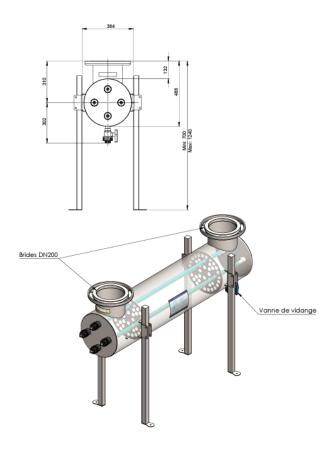

### **INSTALLATION**

The dechloramination unit must be installed horizontally: water flow can be in either direction, but we recommend that the water flows in from the top and out from the top of the unit to avoid any accumulation of air in the treatment chamber and to ensure that it always remains full of water. Sufficient clearance must be provided along the dechloramination unit (1.30 m) to allow for maintenance and UV lamp replacement.

Filtration is required to remove suspended solids. The dechloramination unit is therefore installed after the pool filters, but before chlorine injection as the chlorine molecules can be degraded by UV radiation.

### **MAINTENANCE**

Loss of efficiency occurs when the UV lamps reach the end of their service life (after 2 years of operation) or if one of them becomes defective. They must be replaced. The quartz sleeves make lamp replacement much easier: the unit does not have to be drained or dismantled.

The dechloramination unit is equipped with several lamps, which must all be replaced at the same time. The guartz sleeves may become clogged and should be cleaned once a year with a mild

